




Mastercool[®] Inc.
"World Class Quality"

**"INSPECTOR" 2 IN 1
 ELECTRONIC/UV LEAK DETECTOR**

**TROUBLESHOOTING
 (55200)**

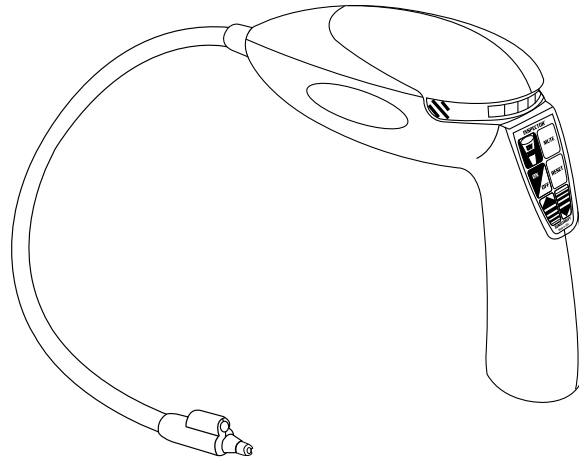

Battery Check: Always check the batteries before any kind of repair. Weak batteries can create false readings.

	ISSUE	SOLUTION
1.	No keypad reaction	Replace the keypad (55200-KEY)
2.	No leak readings	<ul style="list-style-type: none"> • The sensor may need to be replaced (55100-SEN) (Sensors usually last around 20 hours) • The probe may need to be replaced (55200-PR)
3.	When the unit is not responding to any function	<ul style="list-style-type: none"> • Look for loose or broken wires on the PC board • May need to change the PC board (55200-PC)
4.	LED lights do not show any readings	Replace the LED light (55100-LED)

REPLACEMENT PARTS

DESCRIPTION	PART #
SENSOR	55100-SEN
PROBE	55200-PR
PC BOARD	55200-PC
KEY PAD	55200-KEY
LED LIGHT	55100-LED